



208-453-9800

FIVE AND SIX SPEED CONVERSION SPECIALISTS

MD-6768M -CC 1967-68 Mustang/Cougar Clutch Cable Installation Instructions



Tool List

Hand drill
1" uni bit drill
7/16" wrench
two ½" wrenches
two 9/16" wrenches
1/2" ratchet
9/16 socket with a 6" extension
pliers

This kit works with Ford cable operated bellhousing (T-5, T-45, 3650, T-56, TKO) with a 'cable release' clutch set.

Before beginning, it is very important to check header clearance on the driver's side. Some long tube headers are not compatible with clutch cable kits. If the headers are allowed to super heat the cable, the inner liner will become damaged. The shielding provided will only reduce the heat by 50%. Depending on temperature, 1+ inch of clearance is recommended for the cable.

1

The following exhaust systems are known to work with this kit.

*All stock exhaust manifolds
Most shortie and mid length headers
Hedman 88660, Patriot H8433 Doug's Headers, JBA 6610S, 1650S, 1655S
Ford Powertrain Applications (FPA)*

Ceramic coated headers (and/or header wrap) will greatly reduce radiant heat!

2

If you are installing a used pedal make sure you have the correct pedal, otherwise this kit will not fit properly.

This kit will only work with
1967-68 Mustang and Cougar



3

If the clutch pedal is equipped with a pedal assist spring, it will need to be removed. To remove the pedal spring from above the pedal hanger, remove the mounting bolts to allow the spring to unload.

Tech Tip: *Stuff washers in the gaps with the spring fully extended. This will lighten the load on the mounting bolts and make it easier to remove.*

Use caution while removing the spring!

DO NOT RE-INSTALL THE SPRING.

Installing the spring may cause
the pedal to stay on the floor

This is a good time to inspect the clutch pedal bushing conditions for wear or to install a roller bearing kit (MD-411-1081)

4

Temporarily bolt the support plate to the firewall (as shown). Mark the cable hole location and remove the plate.

Caution:

Do not drill the firewall hole with the plate installed as the support plate may be damaged!



5


Center punch the marked location to keep the drill bit from wandering. Drill a clearance hole with a 3/8" bit.



6

Insert the cable adjuster nut found on the clutch cable into the support plate and slide the O-ring into the groove.

Position the firewall plate in place while passing the 1/4" threaded cable end through the 3/8" hole

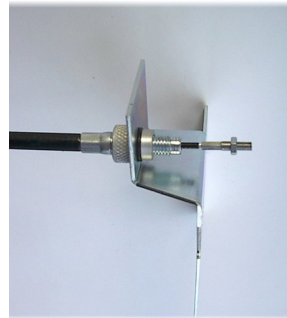

7


Install the fasteners for the brake master cylinder or brake booster. Center the plate to ensure the cable will not drag across the firewall.

(Due to the thickness of the plate, a longer adjustable push rod may be desired to maintain brake pedal height) Check with your local Mustang supply house for one.



8

Thread the 1/4" cable end into the clevis until the end is flush with the clevis. The end of the cable should not protrude into clevis opening. Lock the jam nut against the clevis.

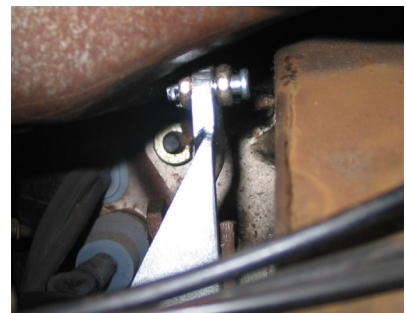

9

For installation from stock linkage to clutch cable, install 1 1/2" body plug into the clutch rod hole.

(For automatic to manual conversion, skip this step)



10

Verify the pedal bracket shoulder is against the clutch pedal. Pull the pedal hanger/support down at the firewall to provide as much room as possible.

Using the slotted hole that bolts the bracket to the clutch pedal, adjust the bracket so it is aligned with the cable housing. Tighten pedal bracket nut.

Verify the bracket does not rub on cowlings.



67 pedal



68 pedal

11

Route the clutch cable under the support brace, around the oil filter and then between the oil pan and driver's side motor mount.

If long tube headers are installed, it is very important to check the exhaust tube clearance next to the cable. If a heat source is less than 1 inch from the cable, the cable will be damaged by heat.


An optional high temp sleeve is available
PN Heatsheild -HT



12

Remove the clutch lever jam nuts from the cable and feed the cable through the bellhousing mounting hole.

Install C-clip to the cable housing to lock the cable housing to the bellhousing. If a scattershield is used, add a spacer to take up the gap.

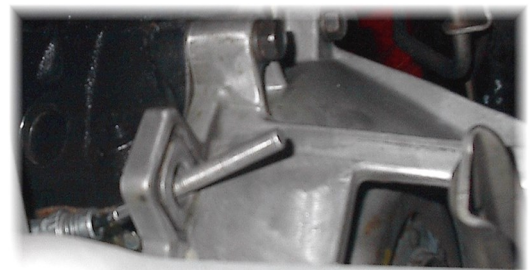

13

Depending on your exhaust system, we recommend mounting the clutch cable clamp to the third oil pan bolt with the bolt and standoff provided. Install the heat shield on the cable between the bell housing and clamp. It is important to keep the cable housing as straight as possible.

**THE CABLE CANNOT TOUCH THE EXHAUST.
ANY CABLE DAMAGE FROM EXCESSIVE HEAT
OR IMPROPER INSTALLATION WILL NOT
BE WARRANTIED!!**



Tri-Y headers shown here with the cable too close.

14

Pass the cable through the clutch lever and install the two cable adjusting nuts on the back side of the lever. Pull all slack out of the cable at the clutch fork and tighten the nuts.

Note: The clutch lever should be about 2/3 back in the bellhousing opening. If the clutch lever is too far forward the pressure plate will not release. An adjustable pivot stud will help in most cases. Too far back means a mechanical pressure plate clutch has been installed. If this is the case, replace clutch with a cable release clutch. An adjustable pivot stud will not overcome this problem.




15

Adjust cable travel at clutch fork. Fine adjustment of the cable can be done at the firewall by turning the adjuster on the support plate. Turning the nut clockwise will tighten the cable. There should be minimal slack in the cable when properly adjusted.

Note: It is ok for the throwout bearing to touch the clutch fingers.

Do NOT preload the throwout bearing.

If you have to preload the cable/bearing to get the clutch to release, most likely the clutch is adjusted too low or the clutch was designed to work with stock mechanical linkage. There should be enough swing in the clutch pedal to move the clutch lever at the bellhousing 1.2" or more.

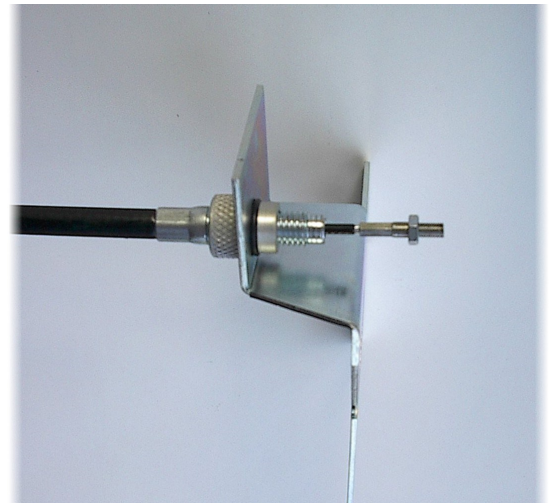

16

Once the cable is working properly...

The clutch should start to engage about 1-2" off the floor with a factory clutch pedal swing/travel. If equipped, install clutch lever cover and double check the cable has not shifted or is rubbing anywhere. Cable movement should be smooth.

If it is difficult or won't release the clutch, re-check earlier steps.

Carefully test drive

For Tech support you can call 208-453-9800

Or Email us at Tech@moderndriveline.com



Thank you for making it Modern!